

# Steel square boxes


## 4" SQUARE OUTLET BOXES – 22.0 CUBIC INCH CAPACITY (WELDED) 21.0 CUBIC INCH CAPACITY (DRAWN)

1 1/2" DEEP – FOR CONDUIT

UL LISTED



TP404/TP404PF

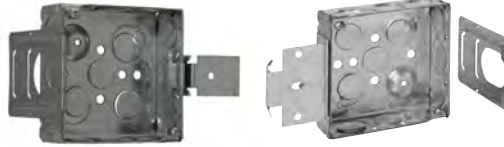

TP404SSB

TP404MSB



TP404RED



TP425



TP469



TP830



TP405



TP412  
TP839



TP410



TP414RED



TP414



TP418



TP423RED



TP467MSB

Cat. #	Metal stud sizes	Bracket	Description	Grounding method	Knockouts		Unit qty.	Wt. lbs. per 100
					Sides	Bottom		
TP404	-	-	Welded	Ground bump	8 - 1/2", 4 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	50	72
TP404G <sup>Ⓞ</sup>	-	-	Welded	Ground bump with screw	8 - 1/2", 4 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	50	72
TP404MSB	-	MSB	Welded	Ground bump	8 - 1/2", 4 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	25	83
TP404RED	-	-	Welded	Ground bump	8 - 1/2", 4 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	50	72
TP404REDMSB	-	MSB	Welded	Ground bump	8 - 1/2", 4 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	25	83
TP404PF <sup>Ⓞ</sup> <sup>ⓔ</sup>	-	-	Welded	Ground bump	8 - 1/2", 4 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	50	72
TP404SSB	-	SSB	Welded	Ground bump	8 - 1/2", 4 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	50	83
TP425	All	"VP"	Welded	Ground bump	6 - 1/2", 3 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	25	82
TP425G <sup>Ⓞ</sup>	All	"VP"	Welded	Ground bump with screw	6 - 1/2", 3 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	25	82
TP423	All	"VMS"	Welded	Ground bump	6 - 1/2", 3 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	25	81
TP423G <sup>Ⓞ</sup>	All	"VMS"	Welded	Ground bump with screw	6 - 1/2", 3 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	25	81
TP423RED	All	"VMS"	Welded	Ground bump	6 - 1/2", 3 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	25	81
TP405	-	-	Drawn	Tapped hole	4 - 1/2", 6 - 1/2" + 3/4" C	3 - 1/2", 2 - 3/4"	50	67
TP410	-	-	Drawn	Tapped hole	12 - 1/2"	5 - 1/2"	50	67
TP412	-	-	Drawn	Tapped hole	8 - 3/4"	3 - 1/2", 2 - 3/4"	50	67
TP414	-	-	Drawn	Ground bump	8 - 1/2", 4 - 3/4"	2 - 1/2", 2 - 3/4"	50	67
TP414G <sup>Ⓞ</sup>	-	-	Drawn	Ground bump with screw	8 - 1/2", 4 - 3/4"	3 - 1/2", 2 - 3/4"	50	67
TP414RED	-	-	Drawn	Ground bump	8 - 1/2", 4 - 3/4"	3 - 1/2", 2 - 3/4"	50	67
TP418	-	"F", set flush	Welded	Ground bump	6 - 1/2", 3 - 1/2" + 3/4" E	2 - 1/2", 2 - 1/2" + 3/4" E	25	84
TP467	-	-	Welded	Ground bump	8 - 3/4"	2 - 1/2", 2 - 1/2" + 3/4" E	50	72
TP467MSB	-	MSB	Welded	Ground bump	8 - 3/4"	2 - 1/2", 2 - 1/2" + 3/4" E	25	78
TP469	All	"VMS"	Welded	Ground bump	6 - 3/4"	2 - 1/2", 2 - 1/2" + 3/4" E	25	81
<b>Air Plenum</b>								
TP830 <sup>Ⓞ</sup>	-	-	Drawn	Tapped screw	8 - 1/2", 4 - 3/4"	3 - 1/2", 2 - 3/4"	50	72
TP839 <sup>Ⓞ</sup>	-	-	Drawn	Tapped screw	8 - 3/4"	3 - 1/2", 2 - 3/4"	50	72

<sup>Ⓞ</sup>For air plenum (no mounting holes) - not UL Listed.

<sup>ⓔ</sup>cUL Listed.

<sup>ⓕ</sup>TP catalog numbers ending in PF include ground screw with pigtail lead.

<sup>Ⓠ</sup>CSA certified.

Steel boxes